



# Errata Sheet

This Errata Sheet contains corrections or changes made after the publication of this manual.

---

**Product Family:** DL405 **Date:** January 25, 2011  
**Manual Number:** DL405-IBOX-S  
**Revision and Date:** Original Edition

---

## Changes to pages 58, 60, 74, 88, 90, 92, 94, 96, and 98

Revise this sentence located near the middle of each of these pages: "Therefore, it is HIGHLY RECOMMENDED that you only execute this IBox ONCE, on first scan."

Replace "on first scan" with "on the second scan".

## Changes to CTRIO Run to Limit Mode (CTRRTLM) (IB-1011)

Page 145. CTRRTLM Example

Replace the Rung 3 ladder example with this one (OUT coils bits changed from "B5056.4" to "B2056.4" and from "B5056.0" to "B2056.0").



## Changes to CTRIO Run to Position Mode (CTRRTPM) (IB-1012)

Page 148. CTRRTPM Example

Replace the Rung 3 ladder example with this one (OUT coils bits changed from "B5056.4" to "B2056.4" and from "B5056.0" to "B2056.0").



## Changes to CTRIO Velocity Mode (CTRVELO) (IB-1013)

Page 5-151. CTRVELO Example

Replace the Rung 3 ladder example with this one (OUT coils bits changed from "B5056.4" to "B2056.4" and from "B5056.0" to "B2056.0").

