



P/N: PMKG
POLE MOUNTING KIT
Installation Instructions:

The kit consists of the following components


- Item A) Strut Rails – QTY (2)
- Item B) Strut Pipe Clamps (Halves, B' & B'') – QTY (2)
- Item C) Fender Washer, 1/4" – QTY (4)
- Item D) Button Head Screws, 1/4-20 X 1/2" Long – QTY (4)

- Item E) Hex Cap Screws, 5/16-18 X 1-1/4" Long – QTY (2)
* 4" pole mount kits use Hex Cap Screws, 3/8-16 X 1-1/2" Long – QTY (2)
- Item F) Square Nuts, 5/16-18 - QTY (2)
* 4" pole mount kits use Square Nuts, 3/8-16 – QTY (2)

- 1) Insert Pipe Clamp halves (B' & B'') into Strut Rails (A) as shown. Do not tighten (x2).
- 2) Attach Rails (A) to the Enclosure Base placing the Rails (A) over the mounting feet boss (x4).
- 3) Secure with Fender Washers (C) and 1/4-20 Screws (D), (x4). Torque to 32 in-lbs Max.
- 4) Straddle the Pipe Clamp halves (B' & B'') around the Pole (not shown), position & align for assembly (x4).
- 5) Secure Pipe Clamps to Pole with 5/16-18 Cap Screws (E) and 5/16 Nuts (F), (x2). Torque to 100 in-lbs Max.
* 4" pole mount kits use Hex Cap Screws 3/8"-16 x 1-1/2" Long and Square Nuts, 3/8-16.

[Integra Enclosures, Inc.](#)

7750 Tyler Blvd / Mentor, OH 44060 / Voice 440-269-8155 / Fax 440-269-4977 / www.integraenclosures.com (INSTALL SHT-PMKG_Rev_C)

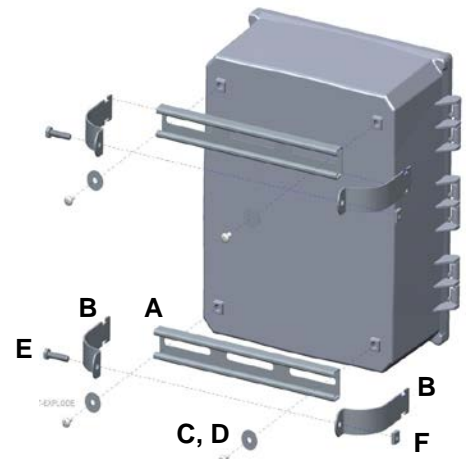

P/N: PMKG
POLE MOUNTING KIT
Installation Instructions:

The kit consists of the following components

- Item A) Strut Rails – QTY (2)
- Item B) Strut Pipe Clamps (Halves, B' & B'') – QTY (2)
- Item C) Fender Washer, 1/4" – QTY (4)
- Item D) Button Head Screws, 1/4-20 X 1/2" Long – QTY (4)

- Item E) Hex Cap Screws, 5/16-18 X 1-1/4" Long – QTY (2)
* 4" pole mount kits use Hex Cap Screws, 3/8-16 X 1-1/2" Long – QTY (2)
- Item F) Square Nuts, 5/16-18 - QTY (2)
* 4" pole mount kits use Square Nuts, 3/8-16 – QTY (2)

- 1) Insert Pipe Clamp halves (B' & B'') into Strut Rails (A) as shown. Do not tighten (x2).
- 2) Attach Rails (A) to the Enclosure Base placing the Rails (A) over the mounting feet boss (x4).
- 3) Secure with Fender Washers (C) and 1/4-20 Screws (D), (x4). Torque to 32 in-lbs Max.
- 4) Straddle the Pipe Clamp halves (B' & B'') around the Pole (not shown), position & align for assembly (x4).
- 5) Secure Pipe Clamps to Pole with 5/16-18 Cap Screws (E) and 5/16 Nuts (F), (x2). Torque to 100 in-lbs Max.

[Integra Enclosures, Inc.](#)

7750 Tyler Blvd / Mentor, OH 44060 / Voice 440-269-8155 / Fax 440-269-4977 / www.integraenclosures.com (INSTALL SHT-PMKG_Rev_C)

